

Manhole Inspection Summary

Manhole # S01WW1007MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **01WW1** Node: **007** Status: **Found**

Insp Date: **9/19/06 12:58 PM**

Incomplete Comments

Crew: **JS, DR**
Inspector: **Smutek, J**
Firm: **REI**

Location Address: **6006 PARKINGTON AVE**

Cross Street: **PARK HEIGHTS AVE**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **2** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **2** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Corbel

Material: **Brick and Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Barrel

Material: **Brick**

☐ Parged

Shape: **Rectangular** Diameter: **46** (in.) Length: **62** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0.5** nearest .5 ft. Azimuth: **-1**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **6** Missing: **0** ☒ **Corroded**

Surcharge

☒ **Evidence Of Surcharge** Depth: **3** (ft.) ☐ Active Surcharge Present

Location View




Top View



Corroded steps.

unknown connection

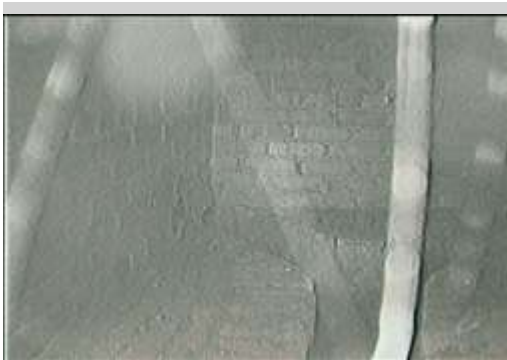

I7?

unknown connection



I5?

Manhole Inspection Summary

Manhole # S01WW1007MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.28** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.15** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S01WW1007MH

Printed On: 12/17/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Direct (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **11.10** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **7.14** (ft.) Flow Characteristics: **None**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop In @ 9 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes**

Reading: **10.09** (ft.)

Inv Depth: **11.09** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection